

# SERVICE

SERVICE KIT NO. SK-122B (Supersedes SK-122A)

DATE:

March 19, 1973

TITLE:

Headliner Replacement - Two-Place Aircraft

SERIALS AFFECTED:

AA1-0458 and AA1-0459, AA1A-0001 thru AA1A-0470, AA1B-0001 thru AA1B-0033, AA1B-0037 thru AA1B-0041, AA1B-0043 thru AA1B-0047, AA1B-0049, AA1B-0051,

AA1B-0053, AA1B-0055, AA1B-0058 and AA1B-0061

WEIGHT AND BALANCE CHANGE: Negligible

Parts List

Quantity	Part Number	Description
1	102344-506	Headliner Assembly
k pint	<b>#6306</b>	Adhesive (Uniroyal)
½ pint	#A851-B	Adhesive (B.F.G.)
1	902020-1	Bracket
2	102306-2	Retainer
26	AES1021A4-6	Screw
1.	AN970-3	Washer
1 .	902020-501	Bracket Assembly
1	MS35206-245	Screw
1	AN960-8	Washer
1,	MS20365-832	Nut
6	1601-0410	Rivet

#### Description of Modification

This kit provides the material and instructions required to:

- 1. Remove a fabric headliner assembly in which the fire retardent chemicals have been determined to be corrosive.
- 2. Remove corrosion from and corrosion proof the aft cabin area as required.
- 3. Install a new vinyl headliner assembly.

#### Modification Instructions

### A. Headliner Removal

TI

- 1. Remove shoulder belts.
- 2. Remove rear side window mouldings.
- 3. Remove cabin speaker and dome light moulding, being careful to insulate cabin light wire as it is hot. (wrap connector with electrical tape).
- 4. Remove upper aft baggage compartment panel.
- 5. Pull headliner loose from cabin top on both sides.
- 6. Pull headliner loose from forward and aft bulkheads.
- 7. Pull headliner support tubes down in the middle and remove headliner assembly.

#### B. Inspection for Corrosion

- 1. Carefully inspect all areas of the cabin interior where the headliner was in contact for signs of corrosion, noting especially the forward fuselage bulkhead, the fuselage center stringer in the dome light area, the aft cabin bulkhead, the cabin top and upper window retainers where the sides of the headliner were glued on.
- C. Corrosion Removal and Corrosion Proofing

  If corrosion is found, use AC43.13-1, par. 143(b) as a guide and remove corrosion per the following steps:



## SERVICE

SERVICE KIT NO. SK-122B (Supersedes SK-122A) I sw possible cere?

DATE:

March 19, 1973

aw much

TITLE:

Headliner Replacement - Two-Place Aircraft Michopair :

SERIALS AFFECTED:

AA1-0458 and AA1-0459, AA1A-0001 thru AA1A-0470, AA1B-0001 thru AA1B-0033, AA1B-0037 thru AA1B-0041, AA1B-0043 thru AA1B-0047, AA1B-0049, AA1B-0051,

la saluti, resum at me i

production (Marille, cop-wollder the tend parts facilities to dis

- Carlott Sulfate Pre Sive

AA1B-0053, AA1B-0055, AA1B-0058 and AA1B-0061

WEIGHT AND BALANCE CHANGE: Negligible

#### Parts List

Quantity	Part Number	Description
1 1 1	102344-506	Headliner Assembly
½ pint	#6306	Adhesive (Uniroyal)
½ pint	#A851-B	Adhesive (B.F.G.)
1	902020-1	Bracket
2	102306-2	Retainer
26	AES1021A4-6	Screw
1.	AN970-3	Washer
1	902020-501	Bracket Assembly
1	MS35206-245	Screw
1	AN960-8	Washer
1	MS20365-832	Nut
6	1601-0410	Rivet
1161		

## Description of Modification

This kit provides the material and instructions required to:

- 1. Remove a fabric headliner assembly in which the fire retardent chemicals have been determined to be corrosive.
- 2. Remove corrosion from and corrosion proof the aft cabin area as required.
- 3. Install a new vinyl headliner assembly.

### Modification Instructions

### Headliner Removal

- 1. Remove shoulder belts.
- 2. Remove rear side window mouldings.
- 3. Remove cabin speaker and dome light moulding, being careful to insulate cabin light wire as it is hot. (wrap connector with electrical tape).
- 4. Remove upper aft baggage compartment panel.
- 5. Pull headliner loose from cabin top on both sides.
- 6. Pull headliner loose from forward and aft bulkheads.
- 7. Pull headliner support tubes down in the middle and remove headliner assembly.

#### Inspection for Corrosion

- Carefully inspect all areas of the cabin interior where the headliner was in contact for signs of corrosion, noting especially the forward fuselage bulkhead, the fuselage center stringer in the dome light area, the aft cabin bulkhead, the cabin top and upper window retainers where the sides of the headliner were glued on.
- Corrosion Removal and Corrosion Proofing If corrosion is found, use AC43.13-1, par. 143(b) as a guide and remove corrosion per the following steps: